



PRODUCT: AUTOMATED CATWALKS
PC1000

DATE: 03/17/2008

SUBJECT: Update Terminal Blocks to Fuses

SERIAL NUMBERS: 2001 to 2005

DISCUSSION: Fuses are required on the Terminal blocks to protect the radio receiver from accidental current damage.

RECOMMENDATION:


The following Terminal blocks located in the stainless steel electrical box containing the receiver for the wireless radio should be removed and replaced with Fuse Terminal Blocks.

Terminal Blocks: GND, 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14

Existing Components:
E13117 Terminal Block

Replacement Components
E13230 Fuse Terminal Block
E13231 Phoenix Contact Fuse Holder
E13232 1A Fuse



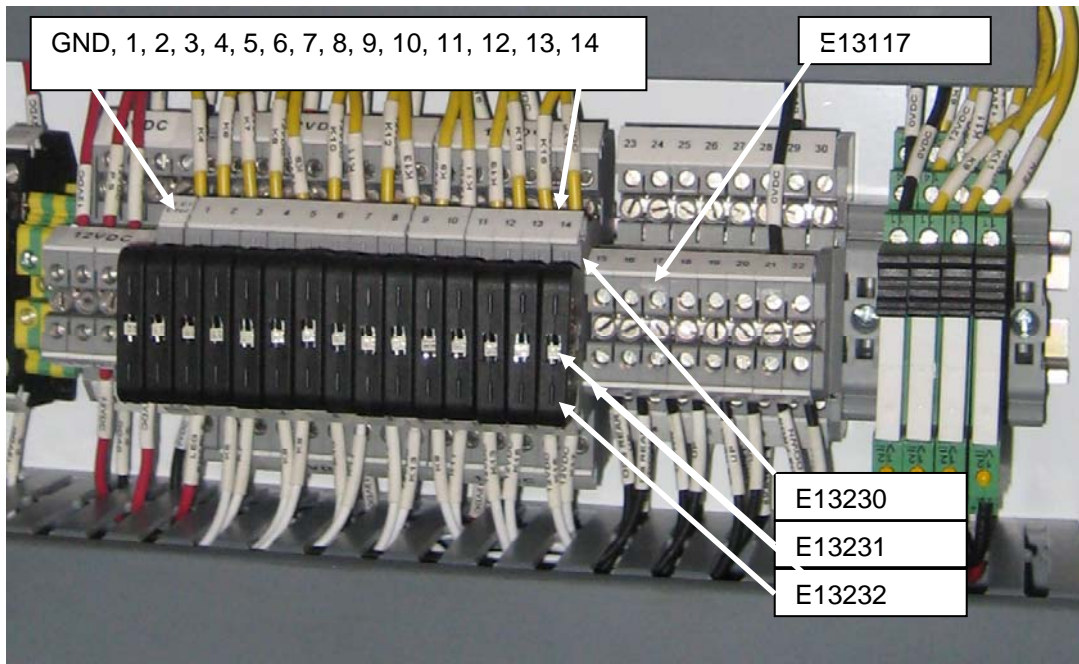

Please contact your Field Service Coordinator to arrange shipment and installation of the parts.

INFORMATION:

For further information contact:

For a complete list of all bulletins go to www.canrig.com

Field Service
Canrig Drilling Technology Ltd.

14703 FM 1488
Magnolia, Texas 77354
Phone: 281.259.8887
Fax: 281.259.8158

7475 51 Street SE
Calgary, AB T2C 4L6
Phone: 403.237.6400
Fax: 403.233.2667